

SPEED-UP KIT (MD) P/N 7247


DESCRIPTION: This kit is provided to upgrade a Model MD after S/N 02-60025 to a Speed-Up configuration.

WARNING: Use of the old Speed Up Jackshaft Drive Pulley (3V2-3/4), P/N 7240-2, in place

of the jackshaft pulley provided in this kit will overspeed the transmissions and

cause premature failure. This will also void any warranty from Walker.

ITEM	PART		QTY
NO.	NO.	DESCRIPTION	REQ'D
1	7240-1	Jackshaft Drive Pulley (3-1/2/3/4/3V)	1
		(Incl. 2 Set Screws (F171) & 1 Key (F067)	
2	6238	Drive Belt (3V X 345)	1

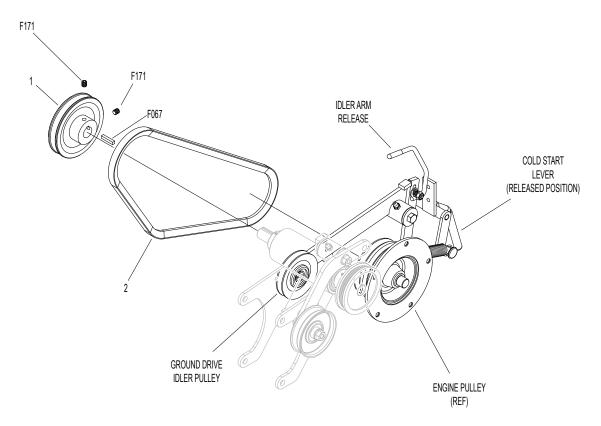

INSTRUCTIONS:

- 1. Remove jackshaft drive belt by disengaging cold start lever and idler arm release to remove belt tension. Remove existing jackshaft drive pulley by loosening set screws.
- 2. Install new jackshaft drive pulley using new set screws and key. Check pulley alignment.