



WALKER
MANUFACTURING CO.

5925 E. HARMONY ROAD
FORT COLLINS, CO 80528 USA
970.221.5614


ADVISORY BULLETIN #22288

APRIL 21, 2022

SUBJECT: Changes to the Jackshaft Assembly Design

MODELS AFFECTED: MT and MC tractors prior to S/N 2022-175934

PURPOSE: The jackshaft assembly was redesigned for improved durability resulting in a longer jackshaft and a new mount weldment. To accommodate these changes, the transmission drive pulley must be installed with the hub facing outboard from the jackshaft assembly for the ground drive belt to properly align.

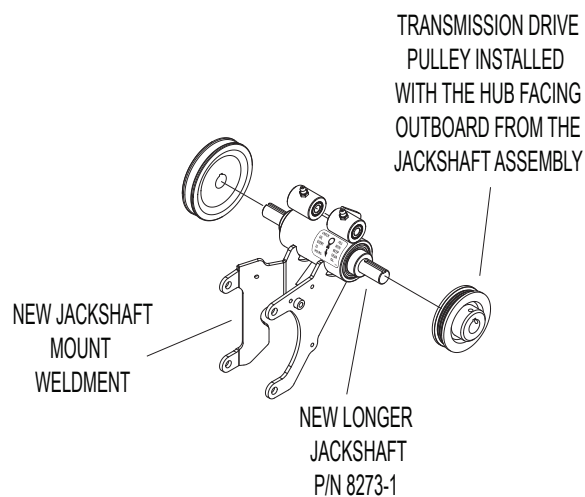

When replacing an entire jackshaft assembly, order the Hydro Jackshaft Mount Kit which comes with the new longer jackshaft (8-1/8").

When replacing just a jackshaft, be sure to order the correct one. The previous jackshaft mount has a bearing housing that measures 3-3/4" which requires the shorter jackshaft (7-1/2"), P/N 8273. The new jackshaft mount assembly has a bearing housing that measures 4-1/4".

	Jackshaft P/N	Jackshaft Length	Bearing Housing Length
Previous Jackshaft Assembly	8273	7-1/2"	3-3/4"
New Jackshaft Assembly	8273-1	8-1/8"	4-1/4"

PARTS REQUIRED:

1. Hydro Jackshaft Mount Kit, P/N 8394-6 (includes #2)
2. Jackshaft (3/4 x 8-1/8), P/N 8273-1



walker.com